

Kempact

MIG 2530



| | |
|----------------------------|-----------|
| Operating manual | EN |
| Käyttöohje | FI |
| Bruksanvisning | SV |
| Bruksanvisning | NO |
| Brugsanvisning | DA |
| Gebrauchsanweisung | DE |
| Gebruiksaanwijzing | NL |
| Manuel d'utilisation | FR |
| Manual de instrucciones | ES |
| Instrukcja obsługi | PL |
| инструкции по эксплуатации | RU |
| 操作手册 | ZH |
| Manual de utilização | PT |
| Manuale d'uso | IT |

OPERATING MANUAL

English

CONTENTS

| | | |
|-------|--|----|
| 1. | Preface..... | 3 |
| 1.1 | General..... | 3 |
| 1.2 | Product introduction..... | 3 |
| 2. | Before you start using the unit..... | 3 |
| 2.1 | Unpacking..... | 3 |
| 2.2 | Placement of the unit..... | 3 |
| 2.3 | Serial number..... | 4 |
| 2.4 | Connection to the mains supply..... | 4 |
| 2.5 | Distribution network..... | 4 |
| 2.6 | Ground cable..... | 4 |
| 2.7 | Wire feeding mechanism components..... | 4 |
| 2.8 | Installation of welding gun..... | 6 |
| 2.9 | Mounting and locking of wire reel..... | 6 |
| 2.10 | Automatic wire feed to gun..... | 6 |
| 2.11 | Adjustment of pressure..... | 6 |
| 2.12 | Adjustment of tightness of reel brake..... | 7 |
| 2.13 | Shielding gas..... | 7 |
| 3. | Operation..... | 8 |
| 3.1 | Main switch and signal lights..... | 8 |
| 3.2 | To select polarity for welding..... | 8 |
| 3.2.1 | Changing the polarity..... | 8 |
| 3.3 | Panel..... | 9 |
| 3.4 | Selecting the welding procedure (2T/4T)..... | 9 |
| 3.5 | Adjusting welding dynamics..... | 10 |
| 3.6 | Thermostat..... | 10 |
| 3.7 | Wire feed switch..... | 10 |
| 4. | Maintenance..... | 11 |
| 4.1 | Daily maintenance..... | 11 |
| 4.2 | Regular maintenance..... | 11 |
| 4.3 | Disposal of the machine..... | 11 |
| 5. | Ordering numbers..... | 11 |
| 6. | Technical data..... | 12 |

EN

1. PREFACE

1.1 General

Congratulations on choosing Kempact series welding equipment. Used correctly, Kemppi products can significantly increase the productivity of your welding, and provide years of economical service.

This operating manual contains important information on the use, maintenance and safety of your Kemppi product. The technical specifications of the equipment can be found at the end of the manual.

Please read the operating manual and the safety instructions booklet carefully before using the equipment for the first time. For your own safety and that of your working environment, pay particular attention to the safety instructions in the manual.

For more information on Kemppi products, contact Kemppi Oy, consult an authorised Kemppi dealer, or visit the Kemppi web site at www.kemppi.com.

For Kemppi's standard safety instructions and warranty terms and conditions, please visit our web site at www.kemppi.com.

The specifications presented in this manual are subject to change without prior notice.

NOTE! Items in the manual that require particular attention in order to minimise damage and personal harm are indicated with this symbol. Read these sections carefully and follow their instructions.

Disclaimer

While every effort has been made to ensure that the information contained in this guide is accurate and complete, no liability can be accepted for any errors or omissions. Kemppi reserves the right to change the specification of the product described at any time without prior notice. Do not copy, record, reproduce or transmit the contents of this guide without prior permission from Kemppi.

1.2 Product introduction

The Kempact MIG 2530 is compact MIG inverter suitable for repair and installation use, and for light and medium industrial use. The power source and the wire feeding mechanism are contained in the device. The power regulation of the power source is implemented with IGBT transistors operating at a frequency of approximately 30 kHz.

Disclaimer

While every effort has been made to ensure that the information contained in this guide is accurate and complete, no liability can be accepted for any errors or omissions. Kemppi reserves the right to change the specification of the product described at any time without prior notice. Do not copy, record, reproduce or transmit the contents of this guide without prior permission from Kemppi.

2. BEFORE YOU START USING THE UNIT

2.1 Unpacking

The equipment is packed in durable packages, designed specially for it. Nevertheless, before using the equipment, always make sure it was not damaged during transport. Also check that you have received what you ordered and that there are instructions for it. **NOTE!** The packaging material of the products is suitable for recycling.

2.2 Placement of the unit

Place the unit on a horizontal, solid, and clean surface. Shield it from heavy rain and scorching sun. Make sure that cooling air circulates freely.

2.3 Serial number

The serial number of the unit is marked on the rating plate of the unit. The serial number makes it possible to trace product manufacturing series. You might need the serial number when placing spare parts orders or when planning maintenance.

2.4 Connection to the mains supply

The Kempact 2530 is equipped with a five metre mains cable without a plug. Installation of the plug should be carried out only by a competent electrician. For fuse and cable sizes, see the technical data in the end of this document.

2.5 Distribution network


All regular electrical devices without special circuits generate harmonic currents into distribution network. High rates of harmonic current may cause losses and disturbance to some equipment.

WARNING: This equipment does not comply with IEC 61000-3-12. If it is connected to a public low voltage system, it is the responsibility of the installer or user of the equipment to ensure, by consultation with the distribution network operator if necessary, that the equipment may be connected.

2.6 Ground cable





Fasten the earth clamp of the return current cable carefully, preferably direct onto the piece to be welded. The contact surface of the earth clamp should always be as large as possible. Clean the fastening surface from paint and rust. Use at least 35 mm² cables. Thinner cross-sectional areas cause overheating of connectors.

2.7 Wire feeding mechanism components

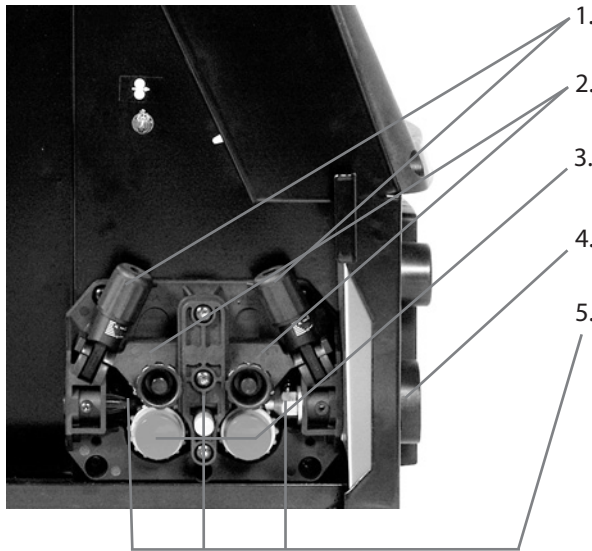

1. Clamp screw
2. Clamping lever
3. Feed rolls
4. Gun connector (Euro)
5. Wire guides

DuraTorque™ 400, 4 wheel wire feed mechanism
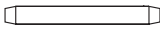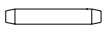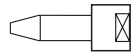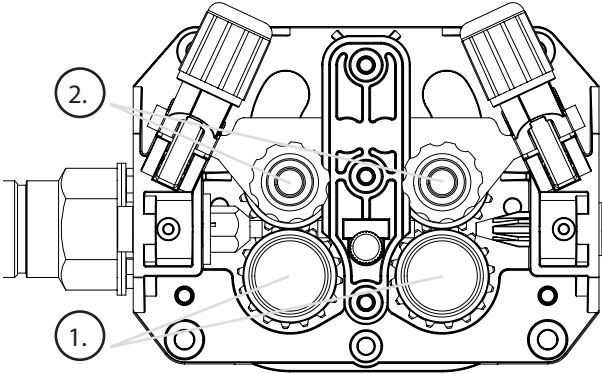
| Wire guide tubes | | | | | | | |
|---|------------------|---|---|---|--|---|---|
| Ss, Al, Fe, Mc, Fc | ø 0,6 ... 1,6 mm | → | ø 2.5/64 mm, W000762, silver, plastic | → | ø 2.5/33 mm, W000956, silver, plastic | → | ø 2.0 mm, W000624, plastic |
| | ø 1,6 ... 2,4 mm | → | ø 3.5/64 mm, W001430, silver, plastic | → | ø 3.5/33 mm, W001431, silver, plastic | → | ø 3.5 mm, W001389, plastic |
| Fe, Mc, Fc | ø 0,6 ... 0,8 mm | → | ø 1.0/67 mm, W001432, white, steel | → | ø 2.0/33 mm, W001435, orange, steel | → | ø 2.0 mm, W000624, plastic |
| | ø 0,9 ... 1,6 mm | → | ø 2.0/64 mm, W001433, orange, steel | | | → | ø 3.5 mm, W001389, plastic |
| | ø 1,6 ... 2,4 mm | → | ø 4.0/63 mm, W001434, blue, steel | → | ø 4.0/33 mm, W001436, blue, steel | → | ø 3.5 mm, W001391, brass |
| | | |  | |  | |  |
|  | | | | | | | |

EN


| Wire feed rolls | | | | |
|------------------------------------|---------|-----------|---------|----------|
| | ø mm | Colour | Drawing | Pressing |
| Fe, Ss, Al, V-groove | 0.6 | pale grey | W001045 | W001046 |
| | 0.8/0.9 | white | W001047 | W001048 |
| | 1.0 | red | W000675 | W000676 |
| | 1.2 | orange | W000960 | W000961 |
| | 1.4 | braun | W001049 | W001050 |
| | 1.6 | yellow | W001051 | W001052 |
| | 2.0 | grey | W001053 | W001054 |
| | 2.4 | black | W001055 | W001056 |
| Fe, Fc, Mc, knurled | 1.0 | red | W001057 | W001058 |
| | 1.2 | orange | W001059 | W001060 |
| | 1.4/1.6 | yellow | W001061 | W001062 |
| | 2.0 | grey | W001063 | W001064 |
| | 2.4 | black | W001065 | W001066 |
| Fe, Fc, Mc, Ss, Al, U-groove | 1.0 | red | W001067 | W001068 |
| | 1.2 | orange | W001069 | W001070 |
| | 1.6 | yellow | W001071 | W001072 |

2.8 Installation of welding gun


Make sure the gun wire conduit and the flow nozzle match the manufacturer's recommendations for the type and diameter of wire you use. Too small a conduit may overload the wire feed device and disturb the wire feeding. Tighten the gun quick connector to eliminate voltage losses. A loose joint will make the gun and the wire feeder warm.

NOTE! Do not use a damaged gun.

2.9 Mounting and locking of wire reel

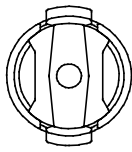

LOCKED

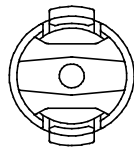

OPEN

- Release locking nails of wire reel hub by turning locking knob a quarter round.
- Mount the reel at its place. Note rotating direction of reel!
- Lock the reel with locking knob, locking nails of hub remain to outside position and will lock the reel.

2.10 Automatic wire feed to gun

Automatic wire feed makes change of wire reel more rapid. In reel change the pressure of feed rolls need not to be released and filler wire goes automatically to correct wire line.

- Make sure that groove of feed roll matches the diameter of welding wire used.
- Release the wire end from reel and cut off the bent length. Be careful that the wire does not spill from the reel to sides!
- Straighten about 20 cm of the wire and see that the end of it has no sharp edges (file off if necessary). A sharp edge may damage the wire guide tube and contact tip of the welding gun.
- Draw a bit of loose wire from wire reel. Feed wire through back liner to feed rolls. Do not release pressure of feed rolls!
- Press the gun switch and feed a bit wire until wire goes through feed rolls to gun. See that wire is in grooves of both feed roll pairs!
- Press still the gun switch until wire has come through contact tip.

Automatic feed may sometimes fail with thin wires (Fe, Fc, Ss: 0.6...0.8 mm, Al: 0.8...1.0 mm). In that case you might have to open feed rolls and feed wire manually through feed rolls.


NOTE! Check that the wire or wire reel does not touch the equipment body, there is a danger of short circuit

2.11 Adjustment of pressure

Adjust the pressure of feed rolls with the control screw so that the wire is fed into the wire guide tube evenly and allows a little braking when coming out from the contact tip without slipping at the feed rolls.

NOTE! Excessive pressure causes flattening of the filler wire and damage to the coating. It also causes undue wear of the feed rolls as well as friction.

2.12 Adjustment of tightness of reel brake

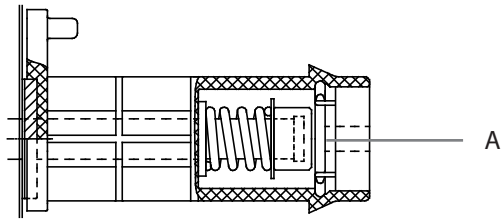

Brake force is adjusted through hole in locking device of reel hub by screwing the control screw (A) with screwdriver.


Adjust brake force as so big that the wire is not allowed to become too loose on the reel so that it would spill from the reel when the rotation of the reel stops. Need for brake force is increased with increase of wire feed speed.

Since the brake loads for its part the motor, you shouldn't keep it unnecessarily tight.

2.13 Shielding gas

The MIG shielding gas consists of carbon dioxide, mixed gases and argon. Shielding gas flow rate is determined by the amount of welding current. The typical flow rate of gas in the welding of steel is 8–15 l / min.

The following installation instructions are valid for most gas flow regulator types:

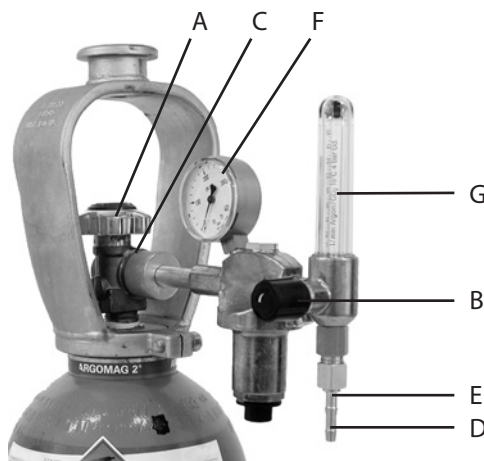

Parts of gas flow regulator

- A. Gas bottle valve
- B. Pressure regulation screw
- C. Connecting nut
- D. Hose spindle
- E. Jacket nut
- F. Gas bottle pressure meter
- G. Gas hose pressure meter

1. Step aside and open the bottle valve (A) for a while to blow out possible impurities.
2. Turn the pressure regulation screw (B) of the regulator until no spring pressure can be felt.
3. Close the needle valve if there is one in the regulator.
4. Install the regulator on bottle valve and tighten the connecting nut (C) with a wrench.
5. Install the hose spindle (D) and jacket nut (E) into the gas hose and tighten with a hose clamp
6. Connect the hose with the regulator and the other end with the wire feed unit. Tighten jacket nut.
7. Open the bottle valve slowly. The gas bottle pressure meter (F) shows bottle pressure.

NOTE! Do not use the whole contents of the bottle. Bottle should be filled when bottle pressure is 2 bar.

8. Open the needle valve if there is one in the regulator.
9. Turn the regulation screw (B) until the hose pressure meter (G) shows the required flow (or pressure). When regulating the flow amount, the power source should be switched on and the gun switch pressed simultaneously.

NOTE! Close the bottle valve after welding is finished. If the machine will not be in use for a long time, unscrew the pressure regulation screw. Always fasten the gas bottle tightly in vertical position, to a wall stand or bottle cart, specially designed for it. For safety reasons, always remove the gas bottle from the transport stand of the machine before lifting or transport of the machine by car!

3. OPERATION

3.1 Main switch and signal lights


With the switch in the 'I' position, the primary and control circuits of the machine become live and the 'ON' signal light on the panel lights up. The welding circuit receives voltage when the gun switch is operated or when the wire feed test switch is pressed.

Always use the main switch to turn the machine on and off with the main switch; do not use the power plug for this purpose.

3.2 To select polarity for welding

Solid wire is usually welded in + pole and cored wire in – pole gun. Check for the recommended polarity on the package or consult the supplier of the product. The welding of very thin plates (0.5 to 0.7 mm) – polarity might also work best for solid wire.

3.2.1 Changing the polarity

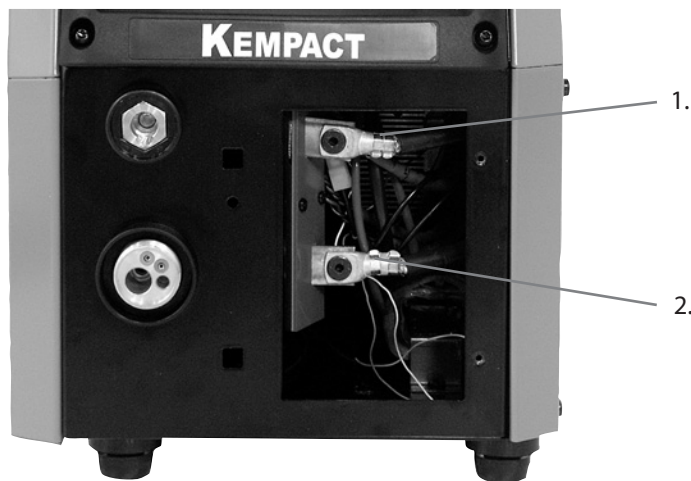


1. – pole
2. + pole

NOTE! Only a service shop authorised by Kemppi may change the polarity.

3.3 Panel

Adjusting voltage and wire feed speed

The welding voltage can be adjusted from 10 to 30 V, and the wire feed speed from 1 to 18 m/min. Adjust the values appropriately by using the table of guideline values on the door of the wire compartment and by testing.

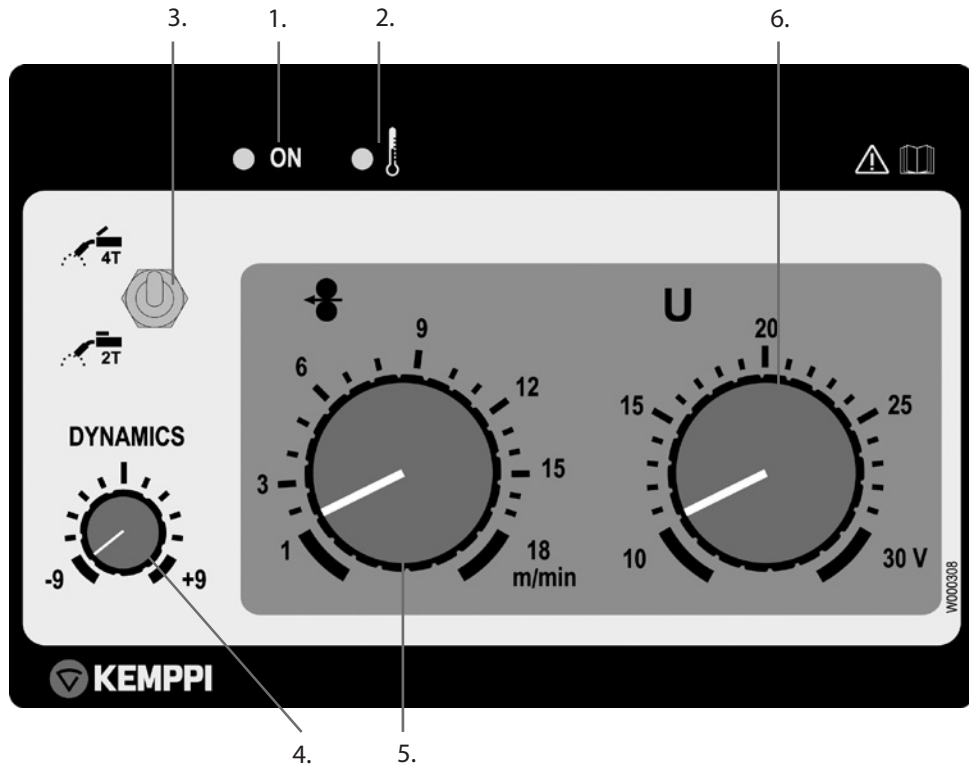

1. ON signal light
2. Thermostat signal light
3. Selecting welding procedure (2T/4T)
4. MIG welding dynamics adjustment
5. Wire feed adjustment
6. Welding voltage adjustment

3.4 Selecting the welding procedure (2T/4T)


2T: MIG welding with double action of the start switch of the gun:

1. Switch closed – welding starts.
2. Switch open – welding ends.

4T: MIG welding with quadruple action of the start switch of the gun:

1. Switch closed – flow of shielding gas starts.
2. Switch open – welding starts.
3. Switch closed – welding ends.
4. Switch open – flow of shielding gas ends.


3.5 Adjusting welding dynamics

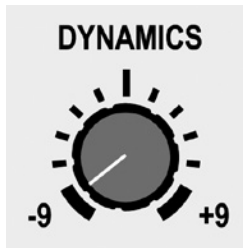

The adjustment of MIG welding dynamics influences the properties of the welding arc and the amount of splatter. The recommended basic setting is '0'. The values -> min (-1...-9) provide a softer arc for diminishing the amount of splatter. The values -> max (1...9) provide a coarser arc, suitable when increased arc stability is desired and when using 100% CO₂ shielding gas for welding steel.

EN

3.6 Thermostat

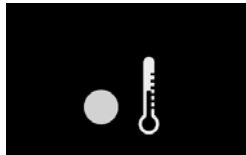

The temperature control of the machine prevents the power source from over-heating. This means that the machine can not become damaged if loading exceeds the specified load factor during welding. When the signal lamp indicating overheating is lit, the welding circuit can not be activated. The lamp will turn off after a pause of about three minutes, and welding can be started again in the usual way by pressing gun switch.

3.7 Wire feed switch



The wire feed switch will start the wire feed motor without opening the gas valve. The power source will start up, but without providing welding power.

4. MAINTENANCE

4.1 Daily maintenance

NOTE! Be careful of mains voltage when handling electric cables!

Clean the wire channel of the electrode and check the contact tip regularly. Always check the condition of the mains and welding cable before operation and replace defective cables.

NOTE! Only a competent electrician is allowed to remove or install the mains cable!

4.2 Regular maintenance

KEMPPI -service workshops sign special service contracts with customers for regular maintenance. All parts are cleaned, checked and if necessary, repaired. Also the operation of the welding machine is tested.

4.3 Disposal of the machine



Do not dispose of electrical equipment with normal waste!

In observance of European Directive 2002/96/EC on waste electrical and electronic equipment, and its implementation in accordance with national law, electrical equipment that has reached the end of its life must be collected separately and taken to an appropriate environmentally responsible recycling facility.

The owner of the equipment is obliged to deliver a decommissioned unit to a regional collection centre, per the instructions of local authorities or a Kemppi representative. By applying this European Directive you will improve the environment and human health.

EN

5. ORDERING NUMBERS

| | | |
|--------------------------------|-------|------------|
| Kempact MIG 2530 | | 621853002 |
| GH 30 Gun holder | | 6256030 |
| MMT 25 | 3 m | 6252513MMT |
| MMT 25 | 4.5 m | 6252514MMT |
| MMT 27 | 3 m | 6252713MMT |
| MMT 27 | 4.5 m | 6252714MMT |
| Earth cable 35 mm ² | 5 m | 6184311 |
| Transport unit ST 7 | | 6185290 |
| Transport unit P250 | | 6185268 |
| Lift hook | | 4298180 |
| Wire spool pole | | 4289880 |
| 5 kg spool adapter | | 4251270 |
| Gas hose | 6 m | W000566 |

6. TECHNICAL DATA

| Kempact MIG 2530 | | |
|--|-------------|--|
| Connection voltage | 3~, 50/60Hz | 380 – 440V ±10% |
| Rated power at max. current | 40% ED | 250 A / 12 kVA |
| Supply current | I_{1max} | 17 A |
| | I_{1eff} | 11 A |
| Connection cable | H07RN-F | 4G1.5 (5 m) |
| Fuse (delayed) | | 16 A |
| Output 40 °C | 40% ED | 250 A / 26.5 V |
| | 60% ED | 207 A / 24 V |
| | 100% ED | 160 A / 22 V |
| Welding range | | 10 – 30 V |
| Open circuit voltage | | 30 – 45 V |
| Power factor at max. current | | 0.64 |
| Efficiency at max. current | | 87% |
| Wire feed speed | | 1 – 18 m/min |
| Filler wires | Fe, Ss | ø 0.6 – 1.0 mm |
| | Cored wire | ø 0.9 – 1.2 mm |
| | Al | ø 0.9 – 1.2 mm |
| | Cusi | ø 0.8 – 1.0 mm |
| Shielding gas | | CO ₂ , Ar, Ar & CO ₂ mixed gases |
| Wire spool (max. ø) | | 300 mm (15 kg) |
| Thermal class | | H(180 °C) / B (130 °C) |
| External dimensions | LxWxH | 580x280x440 |
| Weight | | 20 kg |
| Operating temperature range | | -20 °C ... +40 °C |
| Storage temperature range | | -40 °C ... +60 °C |
| EMC class | | A |
| Degree of protection | | IP23S |
| Standards IEC/EN 60974-1 IEC/EN 60974-5 IEC/EN 60974-10 | | |

KEMPPI OY

Kempinkatu 1
PL 13
FIN-15801 LAHTI
FINLAND
Tel +358 3 899 11
Telefax +358 3 899 428
export@kemppi.com
www.kemppi.com

Kotimaan myynti:

Tel +358 3 899 11
Telefax +358 3 734 8398
myynti.fi@kemppi.com

KEMPPI SVERIGE AB

Box 717
S-194 27 UPPLANDS VÄSBY
SVERIGE
Tel +46 8 590 783 00
Telefax +46 8 590 823 94
sales.se@kemppi.com

KEMPPI NORGE A/S

Postboks 2151, Postterminalen
N-3103 TØNSBERG
NORGE
Tel +47 33 346000
Telefax +47 33 346010
sales.no@kemppi.com

KEMPPI DANMARK A/S

Literbuen 11
DK-2740 SKOVLUNDE
DANMARK
Tel +45 4494 1677
Telefax +45 4494 1536
sales.dk@kemppi.com

KEMPPI BENELUX B.V.

Postbus 5603
NL-4801 EA BREDA
NEDERLAND
Tel +31 765717750
Telefax +31 765716345
sales.nl@kemppi.com

KEMPPI (UK) Ltd

Martti Kemppi Building
Fraser Road
Priority Business Park
BEDFORD, MK44 3WH
UNITED KINGDOM
Tel +44 (0)845 6444201
Telefax +44 (0)845 6444202
sales.uk@kemppi.com

KEMPPI FRANCE S.A.S.

65 Avenue de la Couronne des Prés
78681 EPONE CEDEX
FRANCE
Tel +33 1 30 90 04 40
Telefax +33 1 30 90 04 45
sales.fr@kemppi.com

KEMPPI GmbH

Otto-Hahn-Straße 14
D-35510 BUTZBACH
DEUTSCHLAND
Tel +49 6033 88 020
Telefax +49 6033 72 528
sales.de@kemppi.com

KEMPPI SPÓŁKA Z O.O.

Ul. Borzymowska 32
03-565 WARSZAWA
POLAND
Tel +48 22 7816162
Telefax +48 22 7816505
info.pl@kemppi.com

KEMPPI AUSTRALIA PTY LTD.

13 Cullen Place
P.O. Box 5256, Greystanes NSW 2145
SMITHFIELD NSW 2164
AUSTRALIA
Tel. +61 2 9605 9500
Telefax +61 2 9605 5999
info.au@kemppi.com

ООО КЕМППИ

Polkovaya str. 1, Building 6
127018 MOSCOW
RUSSIA
Tel +7 495 739 4304
Telefax +7 495 739 4305
info.ru@kemppi.com

ООО КЕМППИ

ул. Полковая 1, строение 6
127018 Москва
Tel +7 495 739 4304
Telefax +7 495 739 4305
info.ru@kemppi.com

KEMPPI, TRADING (BEIJING) COMPANY, LIMITED

Room 420, 3 Zone, Building B,
No.12 Hongda North Street,
Beijing Economic Development Zone,
100176 Beijing
CHINA
Tel +86-10-6787 6064
+86-10-6787 1282
Telefax +86-10-6787 5259
sales.cn@kemppi.com
肯倍贸易 (北京) 有限公司
中国北京经济技术开发区宏达
北路12号
创新大厦B座三区420室 (100176)
电话 : +86-10-6787 6064
+86-10-6787 1282
传真 : +86-10-6787 5259
sales.cn@kemppi.com

KEMPPI INDIA PVT LTD

LAKSHMI TOWERS
New No. 2/770,
First Main Road,
Kazura Garden,
Neelankarai,
CHENNAI - 600 041
TAMIL NADU
Tel +91-44-4567 1200
Telefax +91-44-4567 1234
sales.india@kemppi.com